

Order ID 72259

day, July 20, 2011 11:38:49 AM



Page 1

Item ID: D212-664-101

Accept



Setup Start



Revision ID: U/R

Stop



Item Name: Crosstube Fwd

Start Date: 7/20/2011 Start Qty: 1.00

Required Date: 8/10/2011 Req'd Qty: 1.00



Cust Item ID:

Customer:

Reference:

Approvals: Process Plan: *A*Date: *11-07-20* Tooling:

Date:

QC:

Date: SPC (Y/N):

Date:

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D212-664-141	Rev D U/R
--------------	-----------

OK

11.07.22

100

0.00



DC

DOCUMENT CONTROL

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D212-664-101

CHG004

CHG 005

★ SEE ATTACHED W/8 CHG

8 uo2103

110

0.00



Packaging

Pick Kit
Packaging

Memo

0.00

Packaging

DP 11-7-25

120

0.00



CNC Bend 2

BENDING MACHINE - CROSSTUBES

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

*DP / JW**11-7-25*

H:\FORMS

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72259

Wednesday, July 20, 2011 11:38:49 AM

Page 2

Item ID: D212-664-101

Accept

Revision ID: U/R

Item Name: Crosstube Fwd

Start Date: 7/20/2011 Start Qty: 1.00

Required Date: 8/10/2011 Req'd Qty: 1.00

Reference:

Cust Item ID:

Customer:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

130	QC15- Crosstube Dimensional Check	0.00							
-----	-----------------------------------	------	--	--	--	--	--	--	--



QC

Memo

0.00

Quality Control

① 11-07-25

140	Crosstubes	0.00							
-----	------------	------	--	--	--	--	--	--	--



Crosstubes

Memo

0.00

Crosstubes

1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10

2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141

4-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141

SAD
11-07-26

①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72259

Wednesday, July 20, 2011 11:38:49 AM

Page 3

Item ID: D212-664-101

Accept

Revision ID: U/R

Item Name: Crosstube Fwd

Start Date: 7/20/2011 Start Qty: 1.00

Required Date: 8/10/2011 Req'd Qty: 1.00

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

150

Crosstubes Chemical Conversion

0.00



HandFXtube

Memo

0.00

Hand Finishing Crosstubes

Chemical Conversion Coat within 24 hours of bending and drilling

SAD 11-07-27

D

160

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

11 28

170

Outsource process - NDT per QSI038 4.1

0.00



Outsource2

Memo

0.00

Outsource process - NDT

Liquid Penetrant Inspection as per QSI 038
Issue P/O: 14604
LPI as per ASTM 1417 Level 2
Attach copy of NDT results to work order

11-08-2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72259

Wednesday, July 20, 2011 11:38:49 AM

Page 4

Item ID: D212-664-101

Accept

Revision ID: U/R

Item Name: Crosstube Fwd

Start Date: 7/20/2011 Start Qty: 1.00

Required Date: 8/10/2011 Req'd Qty: 1.00

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

Stop

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180



Packaging

Packaging

Receive & Inspect for Damage & Mat'l Certs

Packaging

0.00

Memo

0.00

Ensure copy of NDT results attached to work order.

190



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00

Inspect for damage & ensure results are as per Dwg D212-664-141

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72259

Wednesday, July 20, 2011 11:38:49 AM

Page 5

Item ID: D212-664-101

Accept

Revision ID: U/R

Item Name: Crosstube Fwd

Start Date: 7/20/2011 Start Qty: 1.00

Required Date: 8/10/2011 Req'd Qty: 1.00

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

200

Spray Painting per QSI005 4.2
SprayPaint

0.00



SprayPaint

Memo

0.00

Spray Painting

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube as per DEO D212-667-141 with White Imron as per QSI 005 4.2

PRIME:

Start Time: _____

Finish Time: _____

PAINT:

Start Time: _____

Finish Time: _____

11-07-30

210

QC14- Inspect Spray Paint

0.00



QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

11-08-02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72259

Wednesday, July 20, 2011 11:38:49 AM



Page 6

Item ID: D212-664-101

Revision ID: U/R

Item Name: Crosstube Fwd

Start Date: 7/20/2011 Start Qty: 1.00

Required Date: 8/10/2011 Req'd Qty: 1.00

Reference:

Accept



Setup Start



Stop



Cust Item ID:

Customer:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



Stop



QC:

Date:

SPC (Y/N):

Date:

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

220



Crosstubes

Crosstubes

Crosstubes

Memo

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

2- Install supports with magnobond as per QSI 015 Adhere for for 12 Hrs
A/R 6398 Magnobond Batch: 118234

3- Torque bolts as per dwg

0.00

0.00

0.00

0.00

0.00

0.00

25 11-08-02

★ SEE ATTACHED W/O CHG

230



QC

Quality Control

QC6- Inspect dimensions to drawing

Memo

8 wlog103



240



Packaging

Packaging

Pick Kit

Memo

11/8/30

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____








NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			




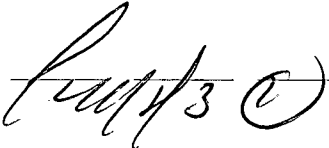

NOTE: Date & initial all entries

Work Order ID 72259

Wednesday, July 20, 2011 11:38:49 AM

Page 7

Item ID:	D212-664-101	Accept		Setup	Start	
Revision ID:	U/R					
Item Name:	Crosstube Fwd				Stop	
Start Date:	7/20/2011	Start Qty:	1.00		Cust Item ID:	
Required Date:	8/10/2011	Req'd Qty:	1.00		Customer:	
Reference:						
Approvals:	Process Plan:	Date:	Tooling:	Date:	Run	Start
	QC:	Date:	SPC (Y/N):	Date:		Stop
						
						

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250  QC Quality Control	QC4- 100% Inspect kits for completeness Memo	0.00 0.00							
260  Packaging Packaging	Packaging Memo Identify and pack for shipping as per PPP D212-664-101	0.00 0.00							
270  QC Quality Control	QC21- Final Inspection - Work Order Release Memo	0.00 0.00							

W 11/08/03

POSITIVE RECALL

EFFECTIVE 11-07-22 AUTH 

RELEASED DATE 

★ NEED DSI 9563 Rev. B

& APPROVED DEO D212-664-1412-2

all to proceed with process only per meeting w/BB MP 11-08-02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, July 20, 2011 11:38:57 AM

Page 1

Work Order ID: 72259

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

Start Date: 7/20/2011

Required Date: 8/10/2011

Start Qty: 1.00

Required Qty: 1.00



Comments:

IPP Rev:E 04.02.16 Reformat KJ/DS

IPP Rev:F 06-03-29 Remove Comments on Pick List JLM

IPP Rev:G 07-04-30 As per Rev C JLM IPP Rev:H

11.04.26 inspection strip ecn 11-549 EC verified by:DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664-101TRN 		Manufactured	No			110	Each	0.0000	1	1			
Crosstube Turning Detail													
D3595-063-450 		Manufactured	No			230	Each	100.5600	4	4.210526			
RUBBER CUSHION													

Location

Loc Qty

Loc Code

LG

100.56

67353

3

68893

6

70113

11.56

71354

80

MS21920-25

Purchased

No

220

Each

124.0000

4

4



Clamp(per MIL-DTL-8783C)

Location

Loc Qty

Loc Code

LG

100

113281

0

113282

0

118142

50

118183

50

LG050

24

116264

2

117998

22

B72039

① DP 11-7-25

4T 11-08-02

X4

4T 11-08-02

X4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, July 20, 2011 11:38:57 AM

Page 2

Work Order ID: 72259

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

Start Date: 7/20/2011

Required Date: 8/10/2011

Start Qty: 1.00

Required Qty: 1.00

D2893-1

Manufactured No

220

Each

1.0000

2

2



2.75 Support

Location

Loc Qty

Loc Code

LG052

1

70736

1

Manufactured No

240

Each

16.0000

1

D3428-1



Placard

Location

Loc Qty

Loc Code

ST053

16

68920

6

71168

10

Purchased No

240

Each

39.0000

4

4

AN6-35A



BOLT

Location

Loc Qty

Loc Code

ST343

39

117441

14

117872

25

Purchased No

240

Each

41.0000

4

4

AN6-36A



Bolt

Location

Loc Qty

Loc Code

ST343

41

117441

21

118012

20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, July 20, 2011 11:38:58 AM

Page 3

Work Order ID: 72259

Parent Item: D212-664-101

Parent Item Name: Crosstube Fwd

Start Date: 7/20/2011

Required Date: 8/10/2011

Start Qty: 1.00

Required Qty: 1.00

MS21042L6

Purchased

No

240

Each

301.0000

6

6



Nut

Location

Loc Qty

Loc Code

ST300

301

117343

1

117677

200

118078

100

AN960JD616

NAS1149D0663J

Purchased

No

240

Each

0.0000

18

18



Washer

MI/8378

11/8/35

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	72259
Description: Crosstube High Fwd (205/212/412)	Part Number:	D212-664-101
Inspection Dwg: D212-664-141 Rev: D		Page 1 of 1

Required Dimension	Min	Max
Height	26.79	27.05
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7

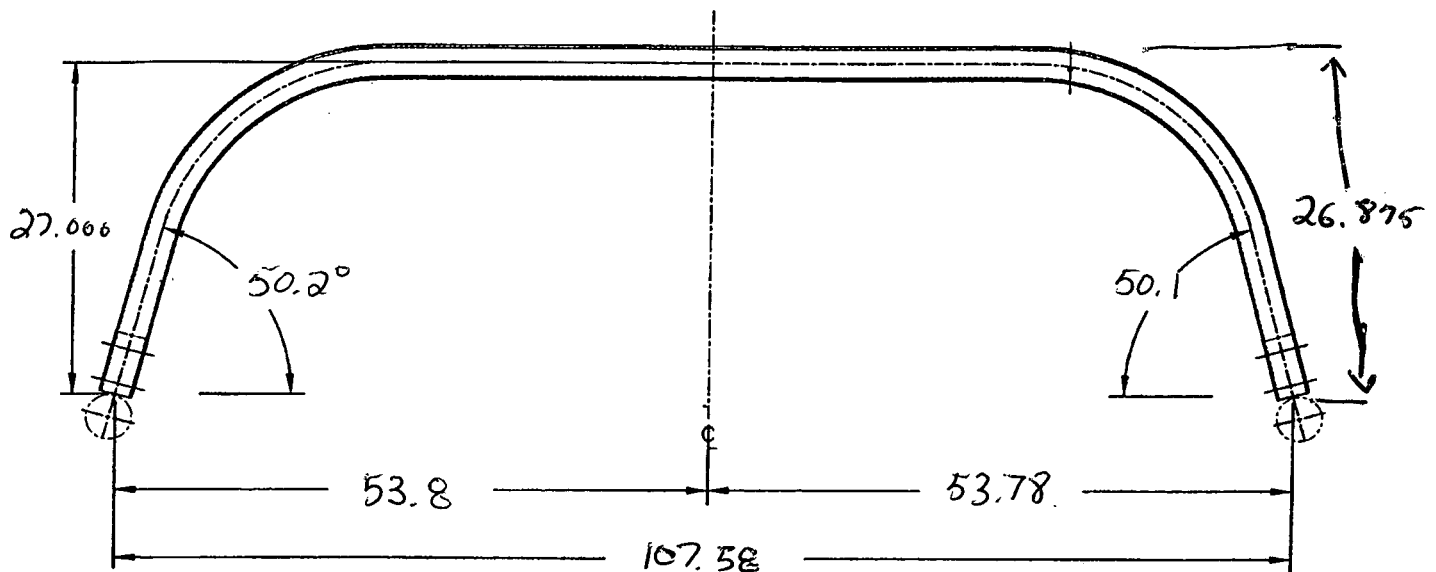

Comments

QC15 Inspection	11.07.25
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.31	Dimensions updated per Dwg Rev C	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -141	Qty -141B	Part Number	Description
1	X		D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X	D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3	1	1	D6005-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	4	4	MS21920-25	CLAMP (OR MS21920-26)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF
USING VIBRATING STYLUS
- 7) WEIGHT: D212-664-141 = 33.6 lbs (PER IIN-D212-664)
D212-664-141B = 33.6 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS
6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF
D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER
INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1
SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE
SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE
SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR
DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND
MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT
HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 72259

11-07-20

UNDER REVIEW

11.06.17
FOR PRO-SEALING SUPPORT

DEO ATTACHED

RELEASED
2009-10-29

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHTAA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	PH	DRAWING NO.	REV. D
MFG. APPR.	PH	D212-664-141	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

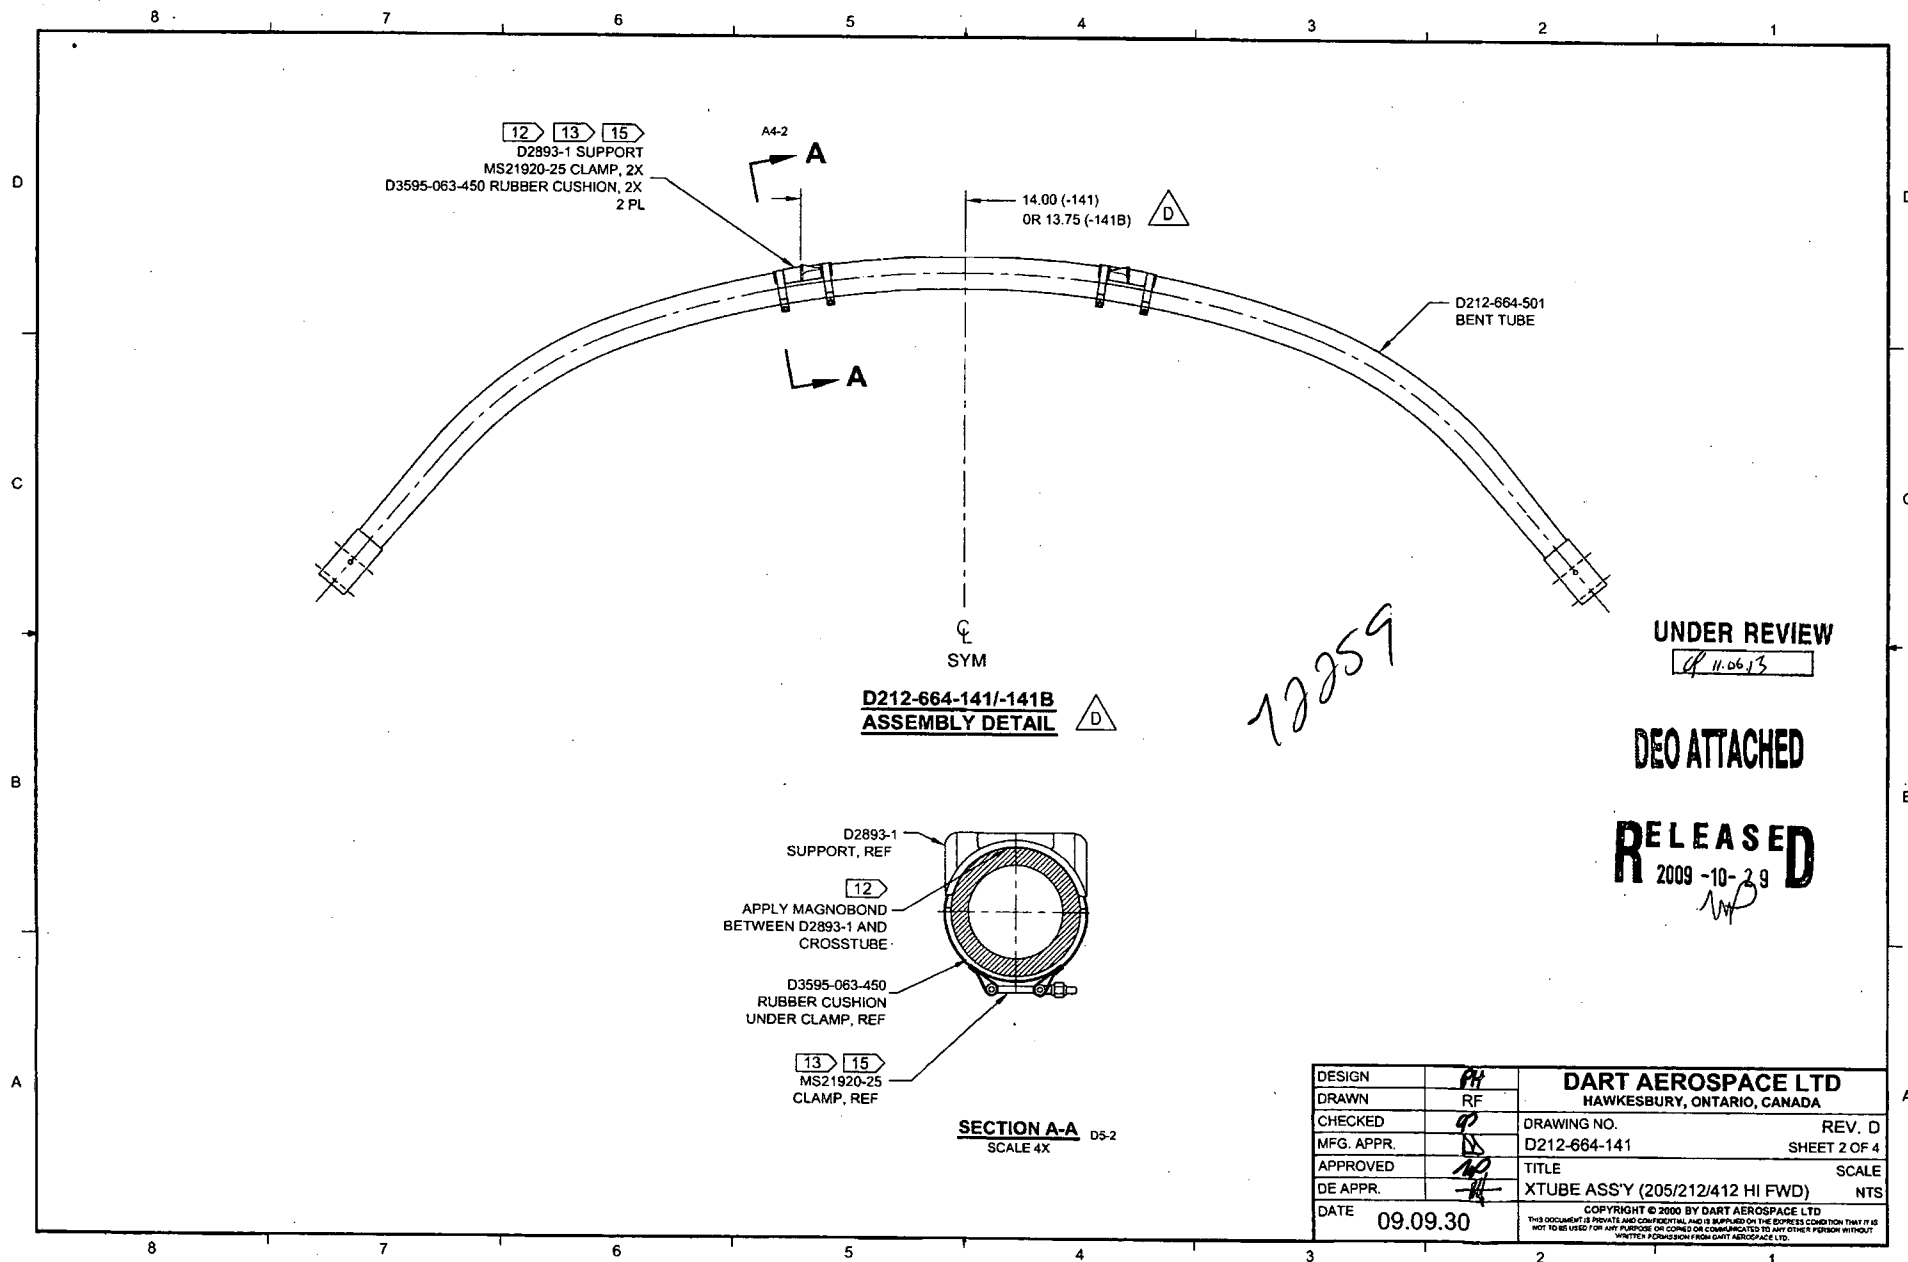


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

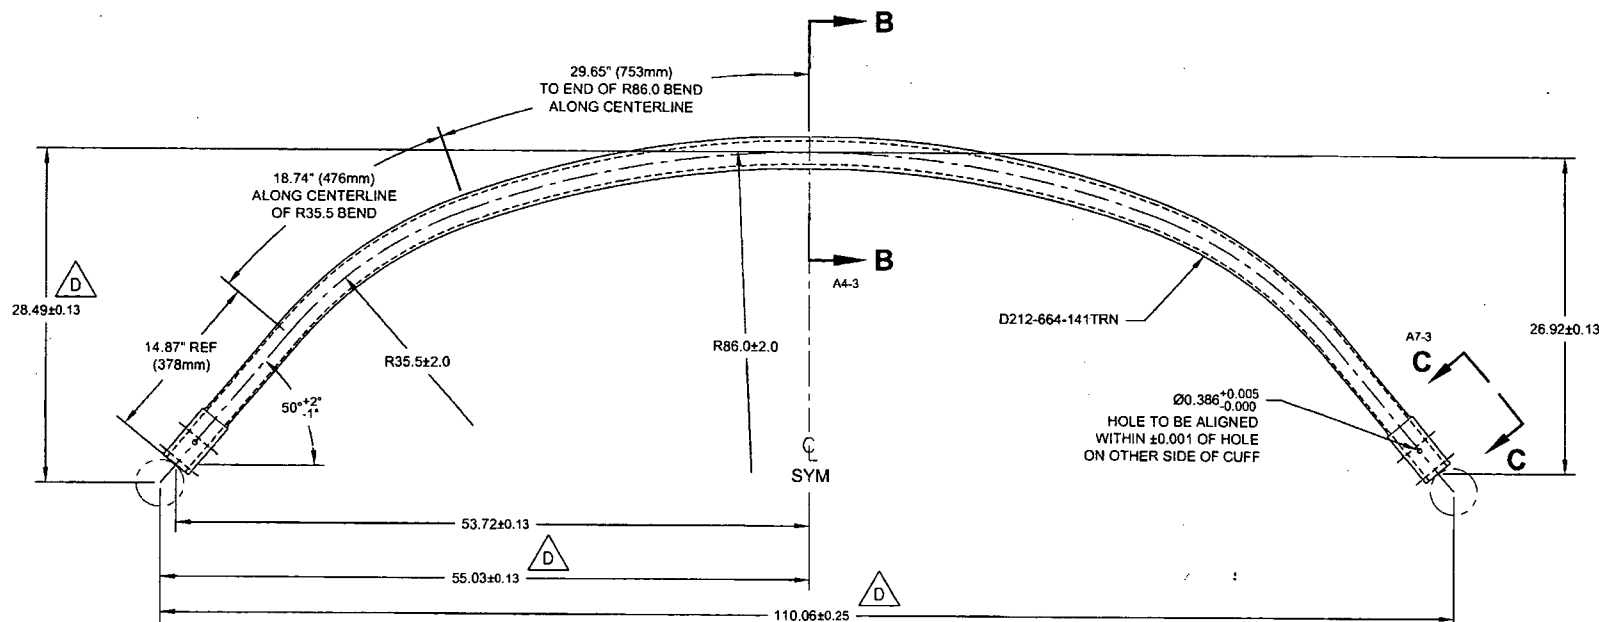


D212-664-501
BENDING AND DRILLING DETAIL




UNDER REVIEW

11.06.13

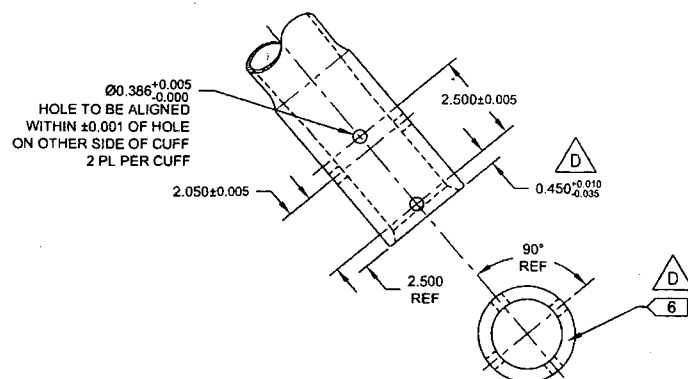

VIEW C-C: CUFF DETAIL
SCALE 3X

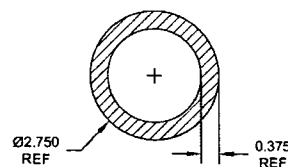

SECTION B-B
SCALE 4X

12259

DEO ATTACHED

RELEASED
2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	92	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	SH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

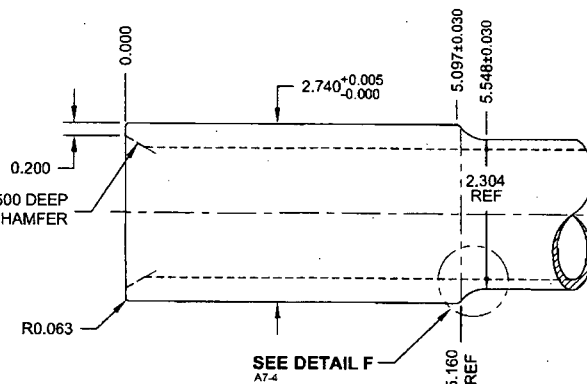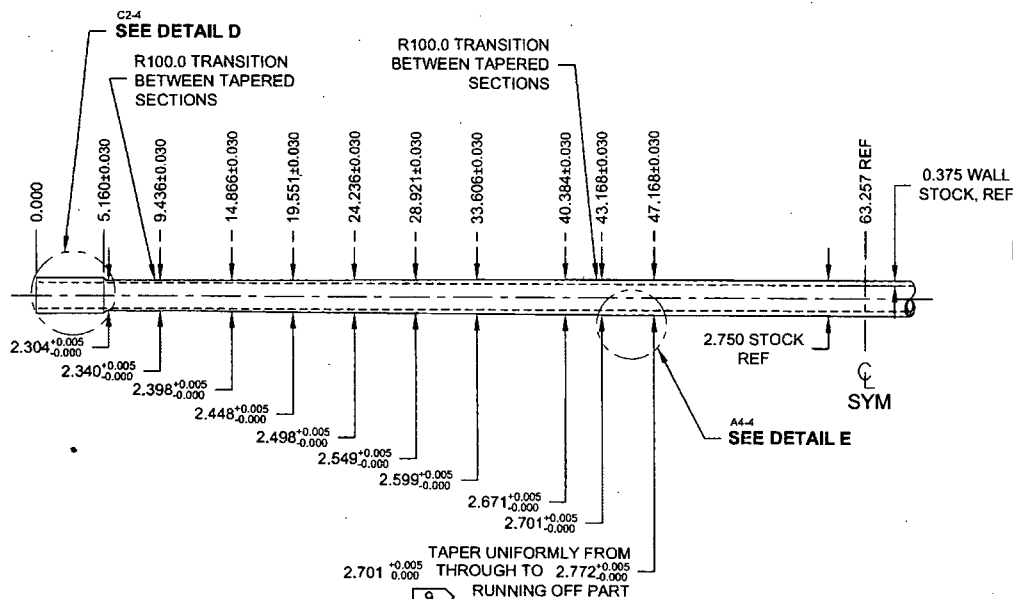


DETAIL D:
CROSSTUBE CUFF D8-4
SCALE 5X

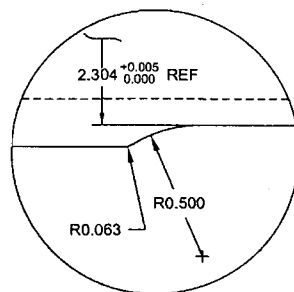

DETAIL F:
CUFF TRANSITION C2-4
SCALE 10X

D212-664-141TRN
TURNING DETAIL

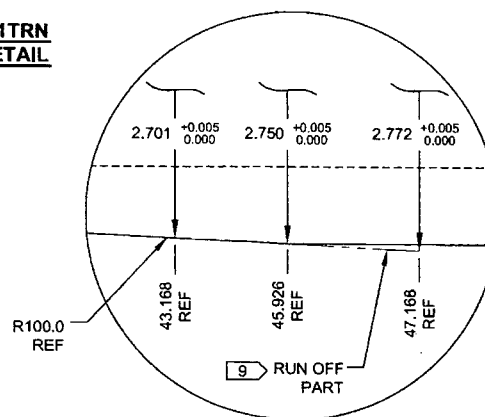

DETAIL E:
TAPER RUN-OFF C5-4
NOT TO SCALE

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	QD	DRAWING NO.	REV. D
MFG. APPR.	DS	D212-664-141	SHEET 4 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	TH	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	09.09.30	COPYRIGHT © 2009 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

UNDER REVIEW

11.06.13

DEO ATTACHED

RELEASED
2009-10-29

and

72259

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12			

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

11.06.13

12259

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


DRAWING NO. D212-664-141	TITLE XTUBE ASSY (205/212/412 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>CP</i>	MFG. APPR. <i>E</i>	APPROVED <i>WD</i>		DE APPR. <i>WD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12		DATE 11.04.12		

IS:

WAS:

UNDER REVIEW


CP 11.06.13

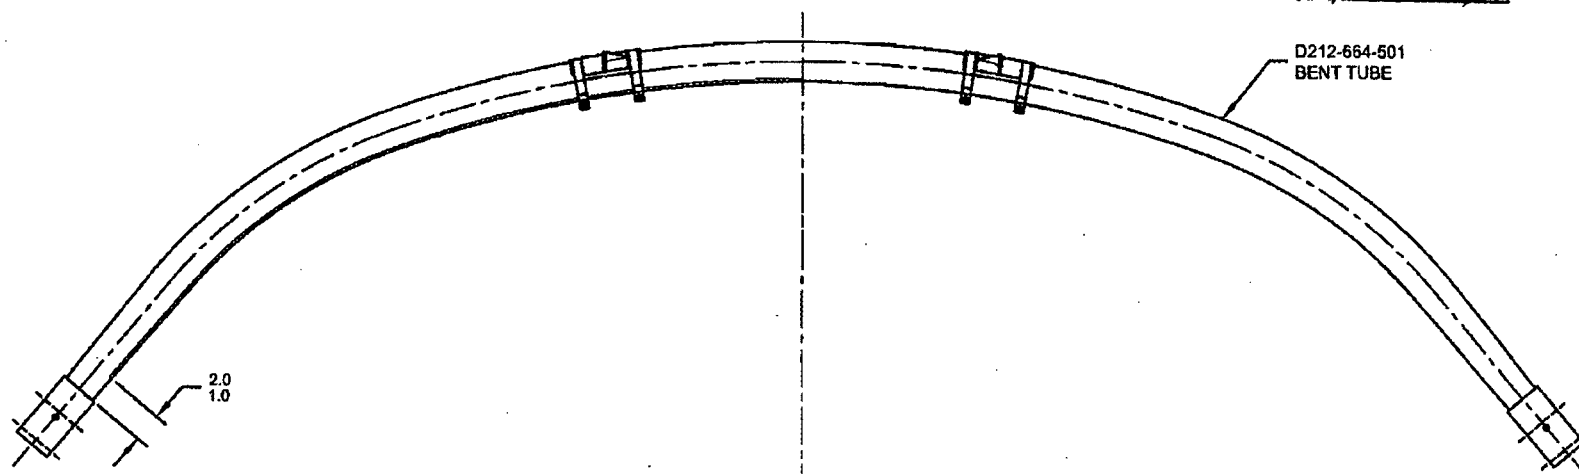

**D212-664-141/-141B
ASSEMBLY DETAIL**

48259

MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT

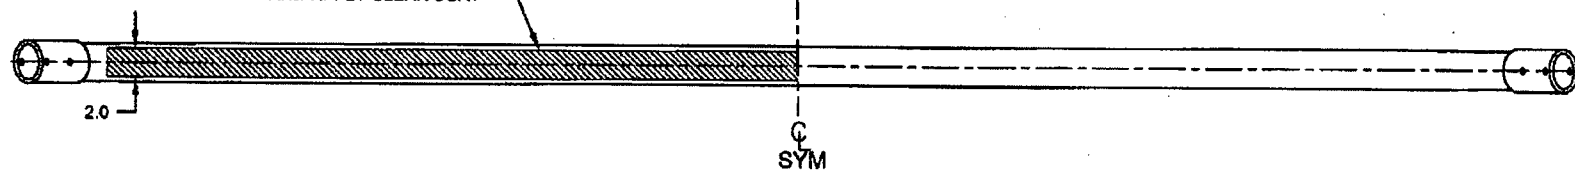

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DRAWING NO. D212-664-141	TITLE CROSSTUBE ASS'Y (205 HI FWD)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-141-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>UP</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>AB</i>	APPROVED <i>MP</i>		DE APPR.		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11/07/21		DATE		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -141	Qty -141B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2893-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

P 11.07.22
PRELIMINARY ISSUE

PRELIMINARY ISSUE


W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
11.07.22	220	- REMOVE FINISH ON SUPPORTS, APPLY 3M 2216 PER ATTACHED REF DWG DZ893 Rev.C. - INSTALL USE PROSEAL 890 PER ATTACHED DED.				GP 11.07.22 05/042	S 11.08/03	
11.07.22	100	- CROSSCHECK Q CHG 005. UPDATE LABELS. - ADD DSI 9563 Rev. <u>B</u> to paperwork				GP 11.07.22 05/042.	S 11.08/03	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

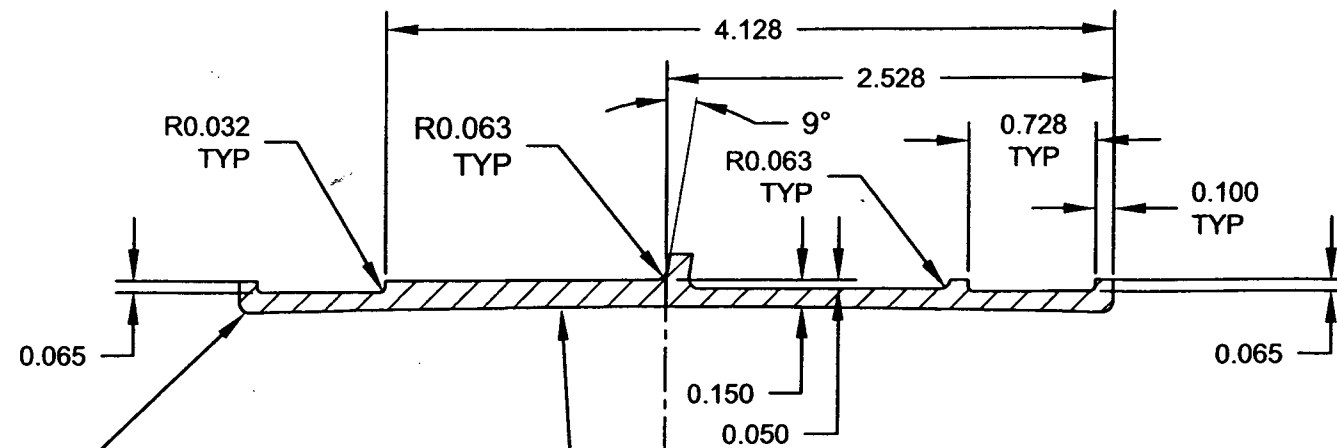


SECTION B-B

PRELIMINARY ISSUE

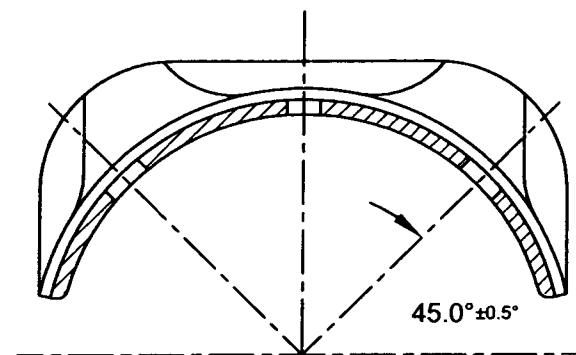


SECTION A-A
TOOLING HOLE DETAIL

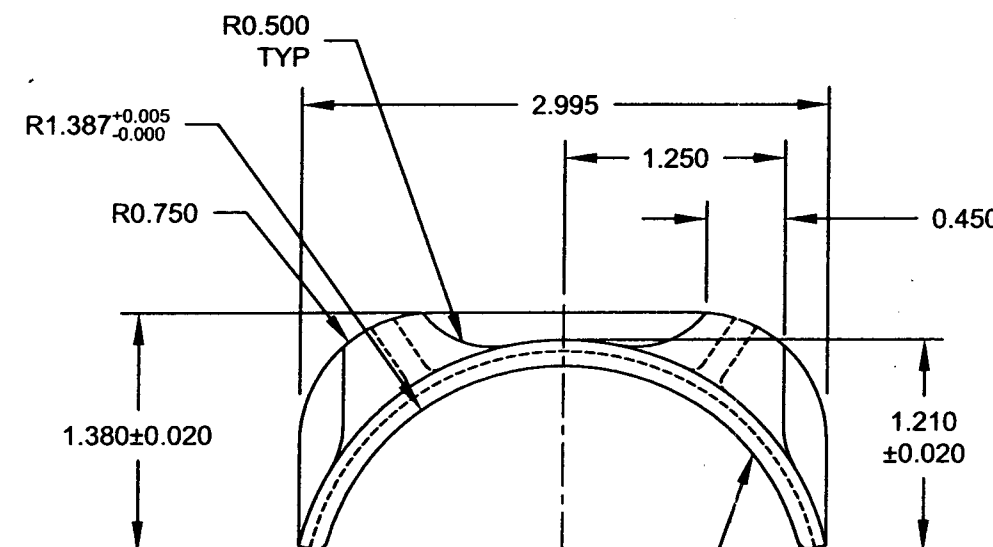

CL
SYM

3M SCOTCH-WELD 2216 B/A
EPOXY ADHESIVE
0.03" - 0.05" THICK

D2893-1 SUPPORT

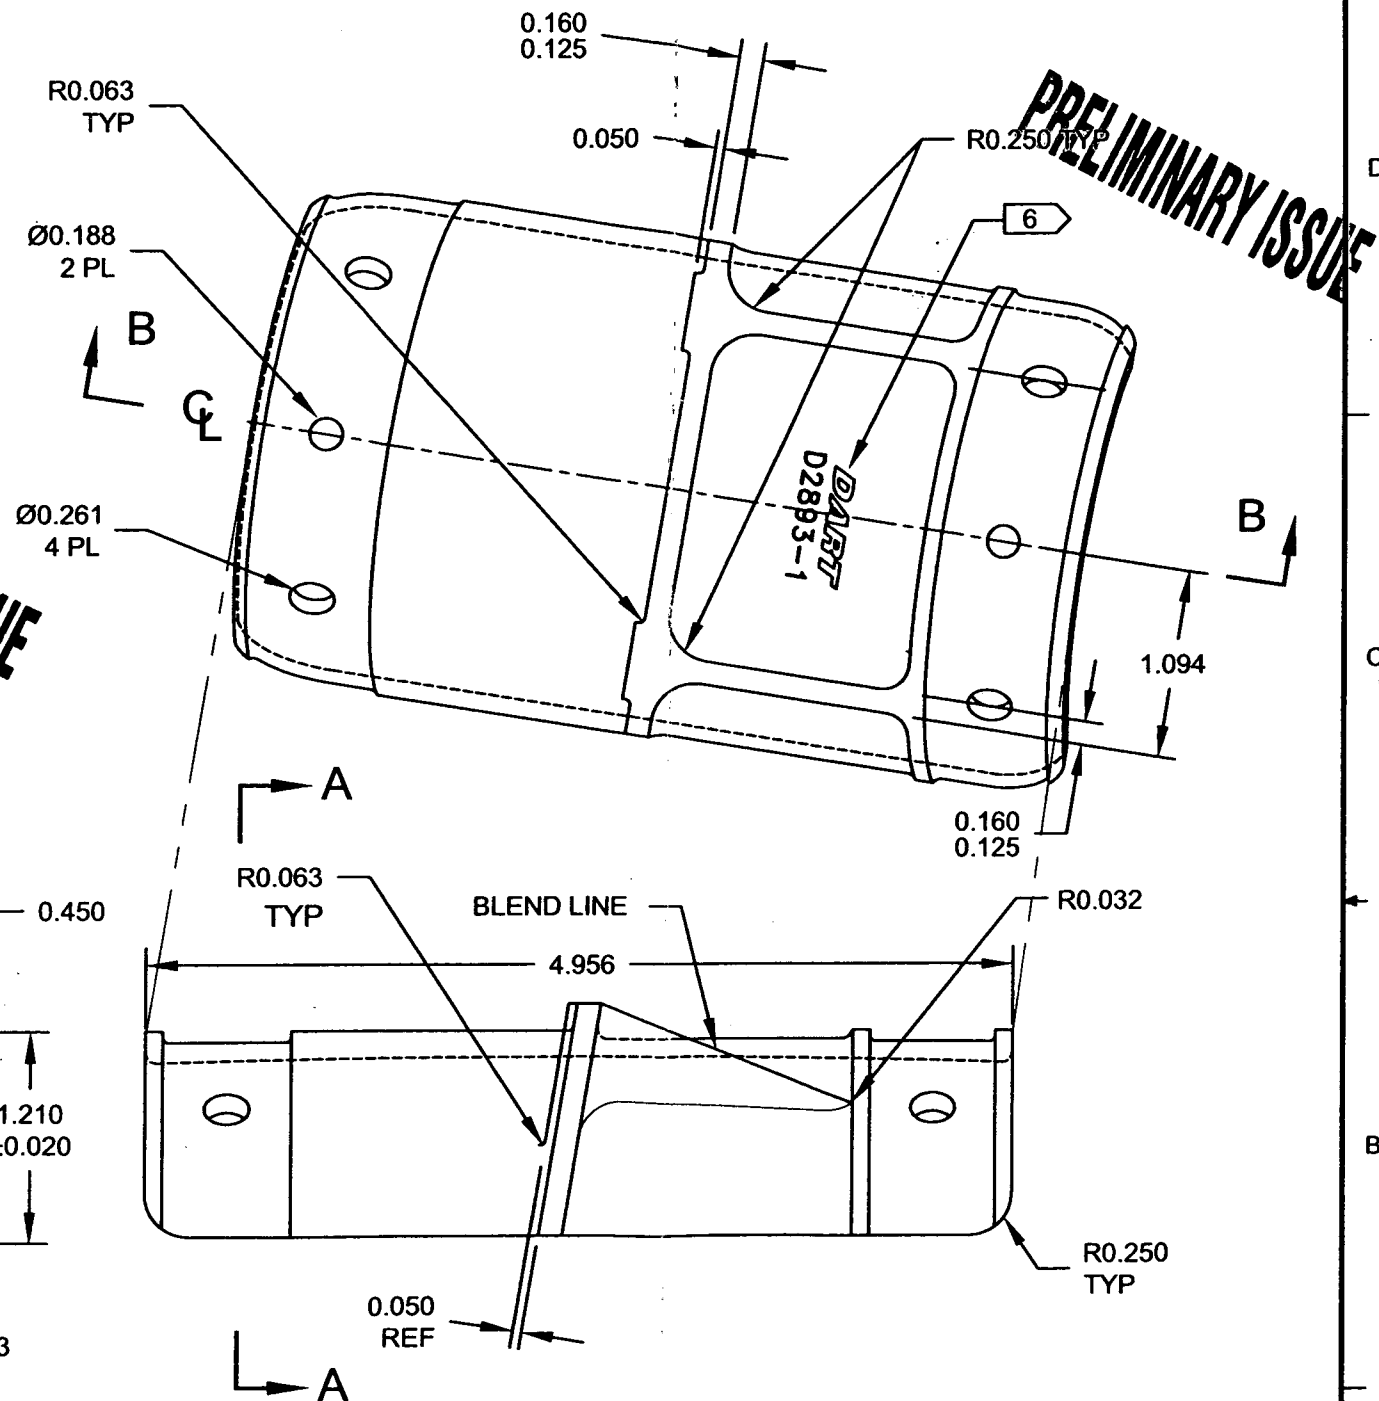

PRELIMINARY ISSUE

NOTES:

1) MATERIAL: 17-4 PH STAINLESS STEEL, H900 OR H925 CONDITION
MIN UTS = 170 KSI (38 HRc)
(REF DART SPEC. D6104)

2) FINISH: NONE

3) TOLERANCES: PER DART QSI 018 (REF X.XXX = ±0.010) UNLESS
OTHERWISE NOTED

4) UNITS: INCHES UNLESS OTHERWISE NOTED

5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX

6) IDENTIFICATION: DART LOGO (PER DART SUPPLIED GRAPHIC) AND PART
NUMBER IN THIS AREA WITH 0.125 HIGH LETTERING
0.010-0.020 DEEP, PER DART QSI 044 6.3.


7) WEIGHT: 0.78 lb

8) FOR THE ENTIRE INNER CONCAVE SURFACE:

ABRADE SURFACE WITH 400-GRIT SANDPAPER. REMOVE RESIDUE WITH MEK
(OR EQUIVALENT). APPLY 0.03" TO 0.05" THICK LAYER OF 3M SCOTCH-WELD 2216 B/A
ADHESIVE TO MATING SURFACE OF SUPPORT. ALLOW TO CURE FOR 24 HOURS.

11.07.22

C	RMV FINISH, ADD 3M 2216, ADD H925 MAT'L OPTION	CP	11.07.15
B	UPDATE DIMS AS MFG, PRIME INSIDE	PH	07.03.16
A	NEW ISSUE	CP	01.01.10
REV.	DESCRIPTION	BY	DATE
DESIGN	ASS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	ASS		
CHECKED	ASS	DRAWING NO.	REV. C
MFG. APPR.	ASS	D2893	SHEET 1 OF 1
APPROVED	ASS	TITLE	SCALE
DE APPR.	ASS	Ø2.750 SUPPORT	NTS
DATE	11.07.15	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

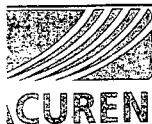

LIQUID PENETRANT TEST REPORT

P- 05625

CLIENT

ATTENTION

ADDRESS

PROJECT

ITEM(S) EXAMINED

DATE

ACUREN JOB NO.

PO/NO.

WORK LOCATION

ACCEPTANCE STD.

PAGE

OF

TIME

AM

PM

DAVE AEROSPACE
LYNDA/CHARITALE/IAN
1270, ABERDEEN RD
HAWKESBURY ON

July 29/2011
183-11-02163

14604

AS ADDRESS

ASTM A1414/1414B

REV./DATE 2005

PT WET FLUORESCENT ON 9 CROSSTUBES & 4 RAPPELS

JOB DESCRIPTION

PROCEDURE NO. LT-002 REV./DATE 2003

TECHNIQUE NO. LT-002

REV./DATE 2003

ART NO.

MATERIAL

ALUMINUM

THICKNESS

N/A

COPE

PERFORMED A WET FLUORESCENT LIQUID PENETRANT INSPECTION ON 100% OF THE
EXTERNAL SURFACE ON ITEMS MENTIONED BELOW

TEST DETAILS

METHOD	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH	<input type="checkbox"/> SOLVENT REMOVABLE	<input type="checkbox"/> POST EMULSIFIED
FAMILY BRAND	MAGNAFLUX		BLACK LIGHT S/N	13798	
PENETRANT	21-67	MINIMUM DWELL TIME	10	MIN.	OUTPUT > 1000 μ W/cm ²
PENETRANT REMOVER	H ₂ O	MINIMUM DRY TIME	>10	MIN.	OTHER
DEVELOPER	SKD-53	MINIMUM DWELL TIME	10	MIN.	LIGHT METER S/N
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS	<input type="checkbox"/> AQUEOUS	<input type="checkbox"/> DRY	CAL DUE DATE	

TEST SURFACE

SURFACE CONDITION	<input type="checkbox"/> AS GROUND	<input type="checkbox"/> AS WELDED	<input type="checkbox"/> MACHINED	<input type="checkbox"/> SHOT BLASTED	<input checked="" type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < -4°C/ 20°F	<input type="checkbox"/> -4°C/ 20°F TO 10°C/50°F	<input checked="" type="checkbox"/> 10°C/50°F TO 52°C/125°F	<input type="checkbox"/> > 52°C/125°F	

RESULTS-

☐ METRIC ☐ IMPERIAL

1	CROSSTUBE	w.o. ID	69959	ITEM ID	D407-667-205	AFT
2	"	w.o. ID	72017	ITEM ID	D212-664-101MB	FWD
3	"	w.o. ID	72059	ITEM ID	D212-664-101	FWD
4	"	w.o. ID	71805	ITEM ID	D407-667-205	AFT
5	"	w.o. ID	71824	ITEM ID	D407-667-205	AFT
6	"	w.o. ID	72260	ITEM ID	D212-664-101	FWD
7	"	w.o. ID	71437	ITEM ID	D212-664-201	AFT
8	"	w.o. ID	72018	ITEM ID	D212-664-201MB	AFT
9	"	w.o. ID	71488	ITEM ID	D212-664-201	AFT
10	RAPPEL	w.o. ID	69692	ITEM ID	D3011-1	

NO RELEVANT INDICATION WAS DETECTED
AS PER APPLICABLE STANDARDS

RT 11-0728

Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE

TECHNICIAN (SIGNATURE):

NAME (PRINT):

IAN TITLEY
PRINT
IVES DESROSIERS
1ST TECHNICIAN

PRINT
SIGNATURE

CGSB LEVEL

SNT LEVEL

CGSB REG. NO.

2049

CGSB LEVEL

SNT LEVEL

CGSB REG. NO.

DTR #

E44712

REPORT

REVIEWED BY:

NAME

INITIALS

5.0 PARTS LIST

5.1 HIGH GEAR CROSSTUBES

Item	-101	-201	-203	Part Number	Description
	X			D212-664-101	CROSSTUBE INSTALLATION, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
		X		D212-664-201	CROSSTUBE INSTALLATION, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
			X	D412-664-203	CROSSTUBE INSTALLATION, 412 HIGH AFT
1	1			D212-664-141	CROSSTUBE ASSEMBLY, 204/205/210/212/214/412, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH FWD
2		1		D212-664-241	CROSSTUBE ASSEMBLY, 204/205/210/212/214, UH-1H, UH-1A/B/E/F/L/P, TH-1F/L, HH-1K HIGH AFT
3			1	D412-664-243	CROSSTUBE ASSEMBLY, 412 HIGH AFT
10	2			* D2893-1	SUPPORT
11	4			* D3595-063-450	RUBBER CUSHION
12	4			* MS21920-25	CLAMP (OR MS21042-26)
13	4			AN6-35A	BOLT
14	4			AN6-36A	BOLT
15	6			MS21042L6	NUT (OR MS21042-6)
16	18			AN960JD616	WASHER
20		2		* D2940-1	SUPPORT
21		4		* D3595-063-530	RUBBER CUSHION
22		4		* MS21920-28	CLAMP (OR MS21042-30)
23		4		AN6-40A	BOLT
24		2		AN6-41A	BOLT
25		6		MS21042L6	NUT (OR MS21042-6)
26		18		AN960JD616	WASHER
30			1	* D2896-1	SUPPORT
31			2	* D2856-600-1009	ABRASION STRIP
32			2	* D3595-063-570	RUBBER CUSHION
33			4	* MS21920-28	CLAMP
34			2	* MS21920-30	CLAMP (OR MS21042-32)
35			4	AN6-40A	BOLT
36			2	AN6-41A	BOLT
37			6	MS21042L6	NUT (OR MS21042-6)
38			18	AN960JD616	WASHER
39			2	* D3189-1	CHAFING SHIELD
50	1	1		D3428-1	PLACARD

*REFERENCE ONLY. PARTS ARE INCLUDED IN D212-664-141/-241 OR D412-664-243 ASSEMBLIES ABOVE
NOTE: KITS INCLUDE EXTRA HARDWARE FOR COMPATIBILITY WITH BOTH DART AND BELL/AA
SKIDTUBES.

• COPYRIGHT © 2001 BY DART AEROSPACE LTD •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED
OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

Revision: F
Date: 08.09.05

Work Order ID 72259

Wednesday, July 20, 2011 11:38:49 AM

Page 1

Item ID: D212-664-101

Accept

Setup Start

Revision ID: U/R

Stop

Item Name: Crosstube Fwd

Start Date: 7/20/2011 Start Qty: 1.00

Required Date: 8/10/2011 Req'd Qty: 1.00

Cust Item ID:

Customer:

Reference:

Run Start

Approvals: Process Plan:

Date: 11-07-20 Tooling:

Date:

QC:

Date: SPC (Y/N):

Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D212-664-141	Rev D U/R OK	0.00							
100	DOCUMENT CONTROL	0.00							
DC	Memo	0.00							
Document Control	Photocopy bluefile and create labels as per PPP D212-664-101								
110	Pick Kit	0.00							
Packaging	Packaging	0.00							
Packaging	Memo	0.00							
120	BENDING MACHINE - CROSSTUBES	0.00							
CNC Bend 2	Memo	0.00							
CNC Alpha 160 Bender	Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101								

11-08-3
★SEE ATTACHED W/S CHG

DP 11-7-25

DP/JT 11-7-25